LASER INTERFEROMETER GRAVITATIONAL WAVE OBSERVATORY



LIGO Laboratory / LIGO Scientific Collaboration

LIGO-E1300598-V1

Advanced LIGO

12 JUL. 2013

BSC4-L1 & BSC9-H1, Requirements & Procedure, Cartridge Flight & Insertion into BSC Chambers, aLIGO

Sam Barnum, Calum Torrie, Eduardo Chavez

Distribution of this document: LIGO Science Collaboration

This is an internal working note of the LIGO Project.

California Institute of Technology LIGO Project – MS 18-34 1200 E. California Blvd. Pasadena, CA 91125 Phone (626) 395-2129 Fax (626) 304-9834 E-mail: info@ligo.caltech.edu

LIGO Hanford Observatory P.O. Box 1970 Mail Stop S9-02 Richland, WA 99352 Phone (509) 372-8106 Fax (509) 372-8137 Massachusetts Institute of Technology LIGO Project - NW17-161 175 Albany St Cambridge, MA 02139 Phone (617) 253-4824 Fax (617) 253-7014 E-mail: info@ligo.mit.edu

> LIGO Livingston Observatory P.O. Box 940 Livingston, LA 70754 Phone (225) 686-3100 Fax (225) 686-7189

http://www.ligo.caltech.edu/

1. Reference Documents

BSC4-L1 D0900471, BSC9-H1 D0901150, Top Level Chamber Assembly


2. Rules about constructing BSC Installation Cartridges:

- 1. Items hung from the BSC-ISI that break the following rules will need to be removed, Or the cartridge will needed to be maneuvered such that rules are maintained.
 - a. Items must fit within support tubes. See Clearance Zone On P2
 - b. Items must fit within all 4 Beams on the Test-Stand. Also see P2
- 2. MAX Cartridge weight without 3PT Lifter is 9,500 lbs. See detailed mass budget *E1000202*.
- 3. CG of the Cartridge in X and Y, must be in the adjustable range of the lifting bar, or masses will need to be added back on, to balance the cartridge (Keel Mass will be removed). Balance may be achieved with temp mass on sidewalls if needed. (In this case, go below 9,500 lbs/4310 kg, then add back on to achieve XY balance).
- Listing of items on ISI, ITM, ETM, BS/FM, TMS, that will need to be locked down when the cartridge is moved. And Cartridge Install procedure.


Conventions:


- 1. Views Labeled TOP are viewed from above looking down
- 2. Views Labeled Bottom are from bellow looking up.
- 3. Views Labeled Front are looking forwards from behind, so you see the back of the Cartridge.
- 4. Views Labeled Left are looking left from right side of the cartridge, so you see the right side.
- 5. All View Names correspond to the Views used in SolidWorks.
- 6. X-Y-Z Triad in each figure is relative to *G1000125*.
- 7. Cranes, and the direction of movement, are referred to by their compass orientation. At LHO: +X=North, +Y=West, LLO: +X=West, +Y=South.

Clearance zone layout for BSC

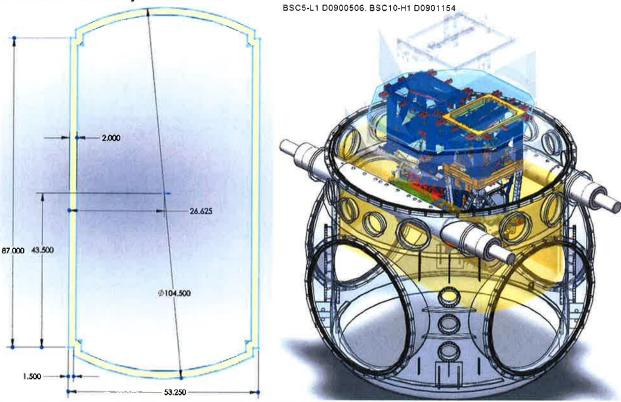

The Clearance Zone is a 2 inch wide area defined between the support tubes, and by the chamber shell. Any items on the cartridge that protrude partly into this zone should be considered for alteration or removal during install. ANY ITEMS THAT PROTRUDE ALL THE WAY INTO, OR THRU, THE ZONE, MUST EITHER BE REMOVED OR ALTERED SO AS TO STAY CLEAR OF THE ZONE FOR INSTALL.

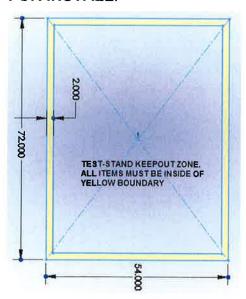


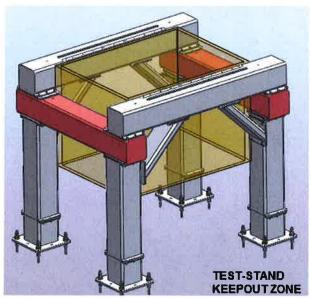

The following pages show the current expected configuration of the BSC cartridge. Any issues with ems violating the Clearance Zone are flagged, and possible cartridge maneuvering with the crane during install is suggested. The locations of the CGs is also shown with reference to the lifting bar on top of the cartridge.


12 JUL. 2013

Start BSC4-L1 D0900471, BSC9-H1 D0901150, Considerations

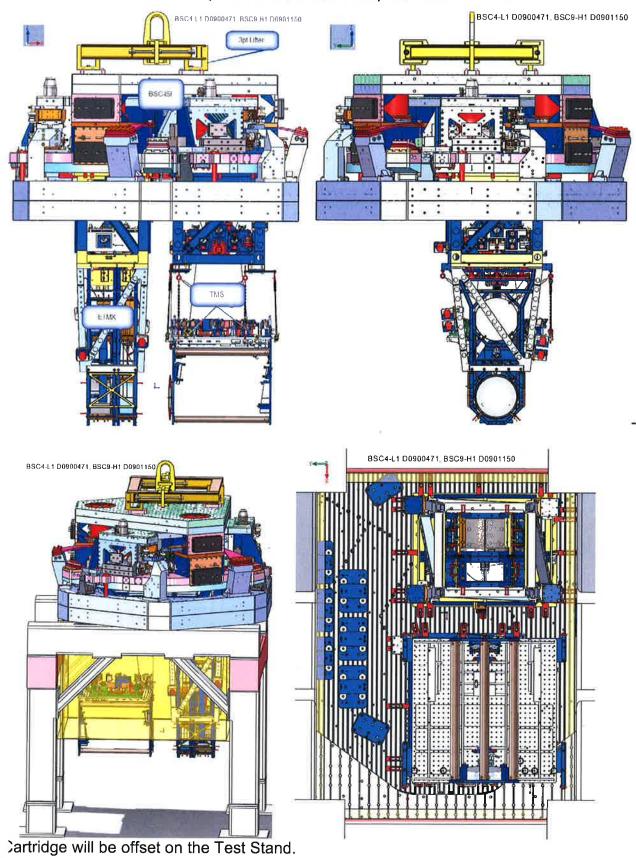


Cartridge installation of BSC. 3pt Lifting bar can cover the range of locations for the XY CG


BSC4-L1 D0900471, BSC9-H1 D0901150, Crane moves need to clear the Test Stand Clearance Zone. (NONE)

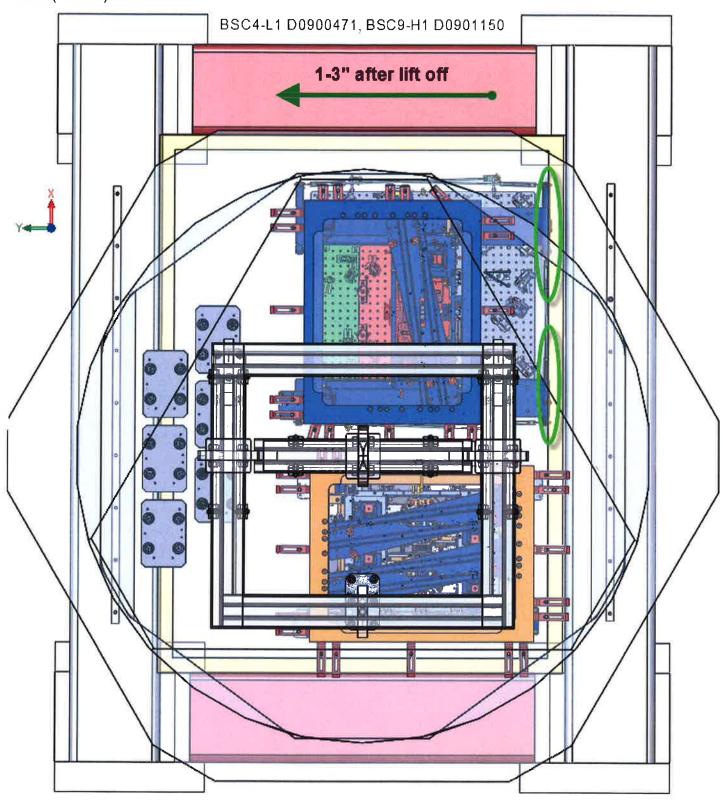

Sircles in green indicate any protrusion into the keep out zone. Any global XY moves relative to the Test-Stand will depend on the orientation of the Test-Stand.

BSC4-L1 D0900471, BSC9-H1 D0901150, will not need to be rotated before insertion into the camber because the test stand is oriented parallel to the support tubes in the BSC chamber.

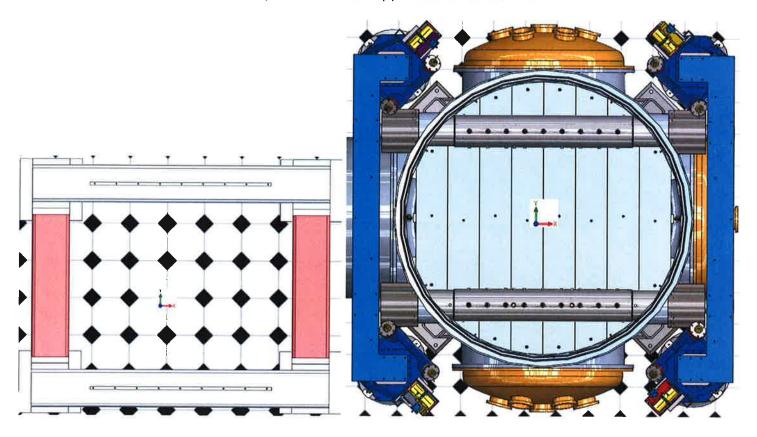

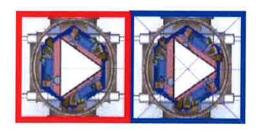


BSC9 H1:ISI-ETMX h1isietmx.mdl BSC-ISI/H1/ETMX/ -BSC5-


H2:ISI-ETMX

h2isietmx.mdl

-BSC-ISI/H2/ETMX/

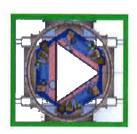


BSC4 L1:ISI-ETMX I1isietmx.mdl BSC-ISI/L1/ETMX/

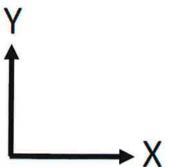


Orientations are from G1000125

BSC4-L1 D0900471, BSC9-H1 D0901150,, Crane moves need to clear the Chamber Clearance Zone. (NONE)

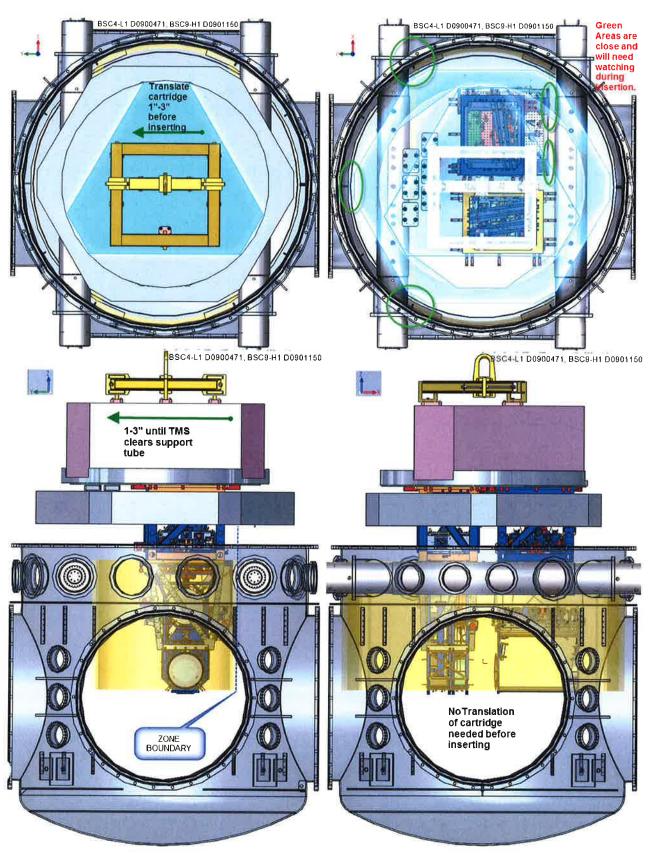

Locating the Bale pre-lift of the cartridge (Some adjustment will be needed)

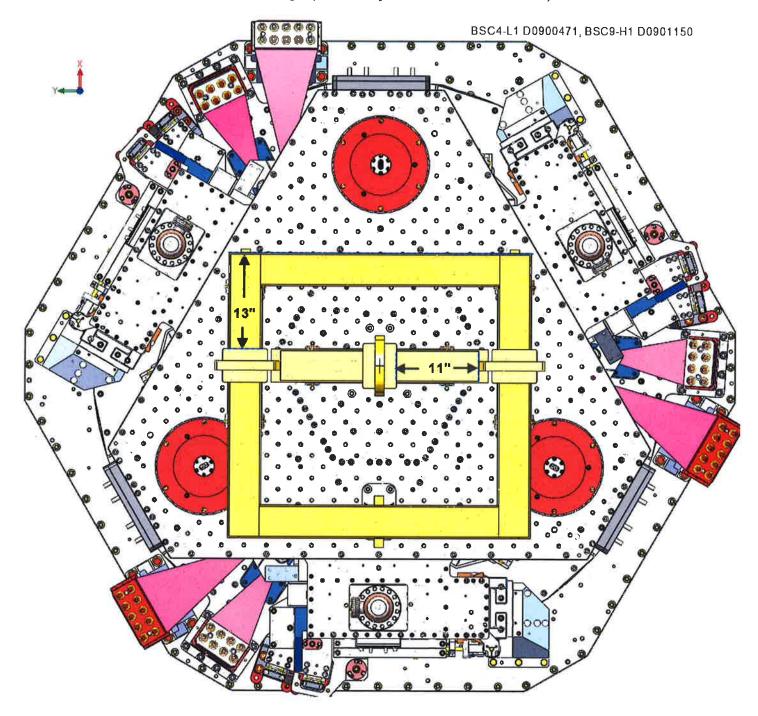

Items that will need to be locked down when the cartridge is moved:

1. **BSC-ISI**: (see <u>E1200344</u> sections 4.2)

<u>completed</u>, <u>approved or checked by:</u> <u>date:</u>

comments (optional):

2. ITMY: Final checks before moving (T1100406):

completed, approved or checked by:

<u>date:</u>

comments (optional):

Cartridge: Preparation for, and installation into Chamber:

aLIGO BSC ISI/Quad Install Procedure: (see E1200344)

completed, approved or checked by:

date:

comments (optional):

LIGO Laboratory / LIGO Scientific Collaboration

LIGO- E1200925-v3

Advanced LIGO

29 Apr 2013

BSC Cartridge Installation Hazard Analysis

Sam Barnum, Dennis Coyne, M. Landry, Brian O'Reilly, Norna Robertson, Calum Torrie

Distribution of this document: LIGO Science Collaboration

This is an internal working note of the LIGO Project.

California Institute of Technology LIGO Project – MS 100-36 1200 E. California Blvd. Pasadena, CA 91125 Phone (626) 395-2129

Fax (626) 304-9834 E-mail: info@ligo.caltech.edu

LIGO Hanford Observatory P.O. Box 1970 Mail Stop S9-02 Richland, WA 99352 Phone (509) 372-8106 Fax (509) 372-8137 Massachusetts Institute of Technology LIGO Project - NW22-295 185 Albany St

Cambridge, MA 02139
Phone (617) 253-4824
Fax (617) 253-7014

E-mail: info@ligo.mit.edu

LIGO Livingston Observatory P.O. Box 940 Livingston, LA 70754 Phone (225) 686-3100 Fax (225) 686-7189

http://www.ligo.caltech.edu/

APPROVAL SIGNATURES

Dennis Coyne, LIGO Chief Engineer	Date
David Nolting, LIGO Lab Safety Officer	Date
Richard Oram, LLO Site Safety Responsible	Date
John Worden, LHO Site Safety Responsible	Date
Brian O'Reilly, Advanced LIGO LLO Installation Lead	Date
Michael Landry, Advanced LIGO LHO Installation Lead	Date
David Shoemaker, Advanced LIGO Leader	Date
Albert Lazzarini, LIGO Directorate	Date

CHANGE LOG

Date, version	Summary of Changes
18 Oct 2012	Initial release for comment (modified from E1200327 BSC2-L1)
25 Oct 2012	1) BIG ONE - is this is now a general HA for ALL Cartridge installs. 2 have now been completed at LHO and one at LLO. As part of this change to general we clarified, noted and identified the following: - 2) Identified risk for damage to Gate-Valve Plumbing and Gate Valve (section 2 and hazard 9) 3) Noted that some keel plate hole patterns are rotated by 120deg from the that shown in the assembly documentation, adjust x-y of the lifter bale position to compensate for rotation. (section 3.4) 4) Spelled out that there is a need to rotate Cartridge to align with chamber, if a rotation of the cartridge is required to align it to the chamber (BSC1,2). (Section 3.5) 5) Updated related documents (section 4) 6) Identified clearly that the cleanroom will be fitted with a 4" spacer between the two halves to provide clearance for the gate-valve motor box. A narrower version of Platform-C will be used in place of the original Platform-C to avoid contact with the gate-valve plumbing (Section
	7) Walking Plate railings will not be reinstalled, due to lack of clearance between them and the incoming Cartridge. (3.8)
26 Apr 2013	Added hazard associated with moving cleanroom while people are resident on work platforms.
29 April 2013	Modified signature page as per D. Nolting

1) Scope

This document covers safety concerns related to the installation of the BSC cartridge from the Test/Assembly stand into the BSC Chamber. The cartridge is comprised of the BSC Internal Seismic Isolation (ISI) with all of the optics table payloads which can be lifted and inserted without interference into the chamber.

The scope includes:

- 1) Preparation and liftoff of cartridge from the Test/Assembly Stand.
- 2) Flight of the cartridge from the Test/Assembly stand to the Chamber.
- 3) Insertion of the Cartridge into the chamber.


This document does not cover the issues associated with the individual suspension and seismic systems that are part of the cartridge. Nor does it cover aspects specific to the crane, or handling of optics. These are covered by other documents.

2) Summary of Hazards


The hazards in this work can be broadly divided into the following areas:

- 1) Moving of heavy, delicate and valuable structures with lifting and moving equipment, with potential for shock/impact if dropped or bumped, leading to the following potential failures/hazards:
 - a) Personnel injury (crushing, pinching, falling).
 - b) Damage to equipment, such as:
 - failure/stretching of wires and/or fibers.
 - misalignment of suspension elements.
- 2) Damage to the suspensions or isolation system,
 - a) Impact against the Test/Assembly Stand.
 - b) Impact against the BSC Chamber and Support Tubes.
- 3) Particulate contamination,
- 4) Cartridge dropped,
- 5) Crane failure (without drop) or Power Failure during operation,
- 6) Crane/Structural failure (Overload crane),
- 7) Drop/fall hazard of tools, etc. due to assembly of components at height,
 - a) While putting covers over cartridge.
 - b) During attachment of 3pt Lifter to cartridge.
 - c) When attaching Cartridge to Chamber support tubes
- 8) Crane rotation failure while cartridge suspended.

3.2 Attach 3pt Lifter to Lift Hook Receivers (*D1003140*), use 5/8"-11 Grade9, equivalent or better (91271A802, 90201A531), 125-128 ft-lb

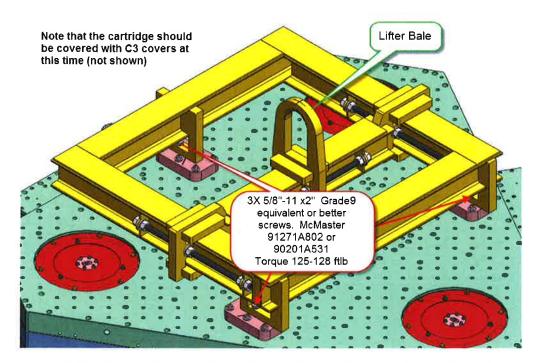

3.3 Crane In position above Cartridge and Test Stand

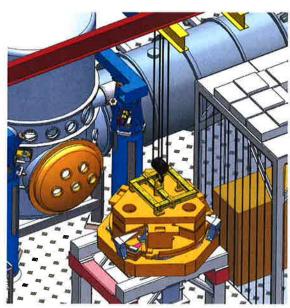


3.4 Adjust 3pt lifter bale (shown below with load cell attached) to predicted X-Y CG location (some keel plate hole patterns are rotated by 120deg from the that shown in the assembly documentation, adjust x-y of the lifter bale to compensate for rotation.) Then **Check Cartridge weight:** Lift cartridge from

test-stand with load cell and crane, If load-cell starts to exceed 10,000lb, stop, and set cartridge back down. Reduce cartridge weight and try again. Record the final total weight, set back down and remove load cell. Record the specific load cell and any needed deviations in the intended payload for the cartridge. If there is a 2" or more gap at any point between the mounting surface of the Test Stand and the mounting surface of the cartridge, the cartridge must be re-leveled. Target gap at any point will be ~ 1/4"




(3pt. Lifter & Load Cell, shown while not attached to cartridge)


3.5 Rotate Cartridge to align with chamber, if a rotation of the cartridge is required to align it to the chamber (BSC1,2): Insure a protective tarp with clean side up has been placed on the floor in the area where the cartridge rotation will take place (cartridge cover may contact floor otherwise). Attach 2 to 4 taglines to 3pt lifter (to rotate cartridge or serve as backup) Lift cartridge to clear Test Stand and move to designated area over tarp. Lower cartridge to minimum practical height without suspensions contacting the floor. Move staging from around test stand, into place to access stage0 if rotation "by hand" is to be done. Using either taglines or the "by hand" method, rotate cartridge to align with chamber orientation. If pivot on hook becomes jammed, return cartridge to test stand. There is clearance to allow this.

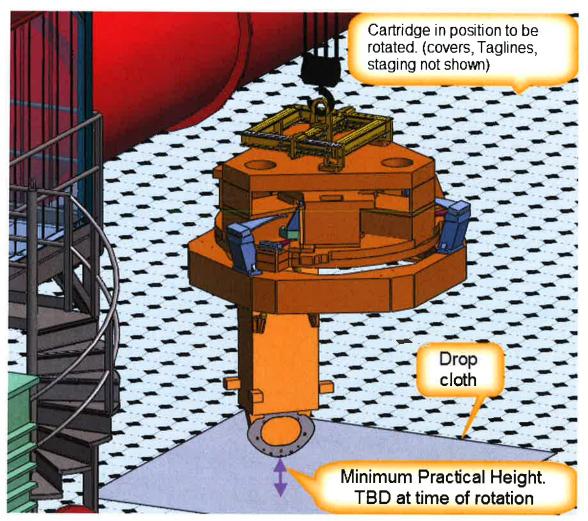


3.6 Lift cartridge up to height to clear BSC Clean-room (max height). BSC Clean-room should already be at minimum height (just above spools), Walking Plates (D1002410) and Platforms (D1001990) should be in place without railings, around chambers (See install procedure E1101051). Clean-room clearance ~8"

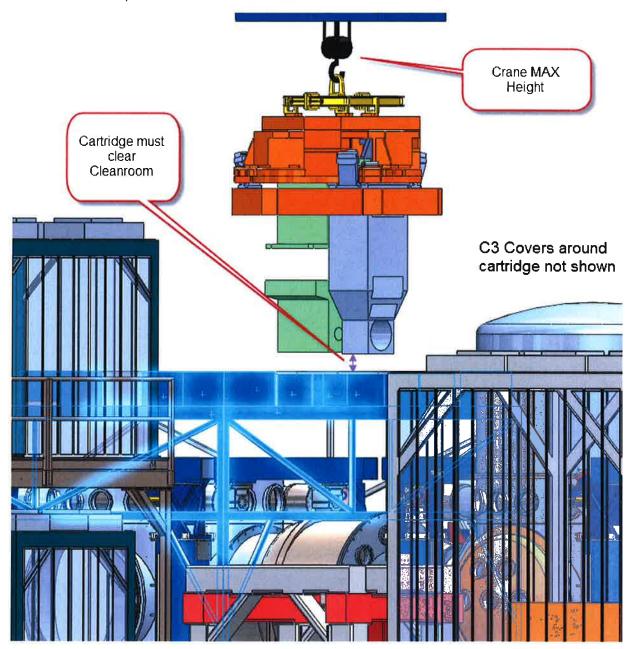


3.7 Move crane to a point centered above target BSC chamber, and BSC Clean-room

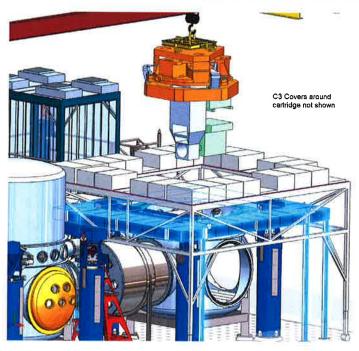

3.8 Raise BSC Clean-room back up to max height, Walking Plate railings will not be reinstalled, due to lack of clearance between them and the incoming Cartridge. Fall arrest system will be used (personal harness, lanyard, anchor points,) to prevent falls.

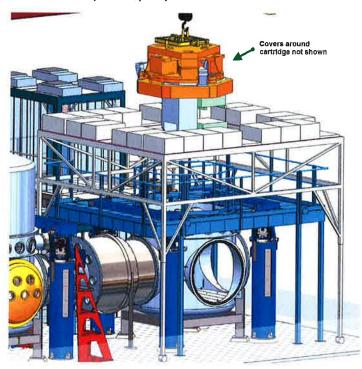

3.9 Lower cartridge to just above chamber, and role up outside cover to expose stage0, remove fabric cover from chamber. Continue to lower cartridge onto support tubes in chamber.

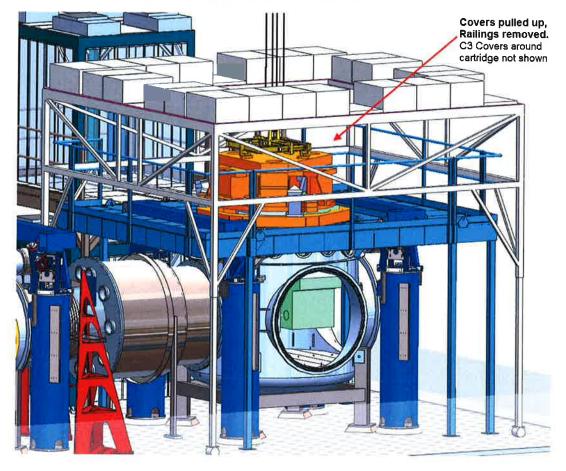

3.10 Insert 3/8"-24 x 2" screws into all 14 holes. Torque 21 ft.lb, Then remove 3pt Lifter, close up clean room, finish removing C3 covers.

4) Related Documents

- <u>LIGO-E1200023</u>: aLIGO Chamber Installation Procedures.
 (See related documents specific to the BSC Cartridge being installed)
- <u>LIGO-E1200900</u>: BSC Installation Procedures (from sub-systems)
- <u>LIGO-E1200901</u>: BSC Safety Procedures(associated with install)
- <u>LIGO-E1101051</u>: BSC Work Platforms Assembly Instructions
- LIGO-E1200344: All BSC, Basic Cartridge Install, aLIGO
- LIGO-E1101017: Cartridge Lifting Hardware, Loading Analysis.

5) Hazard Analysis

Each hazard, and mitigation approach or measure, is listed in the severity table in the next section

- 5.1 While moving heavy, delicate and valuable structures using lifting and moving equipment, there is potential for injury, shock and/or impact if structures are dropped or bumped.
- Personnel injury (crushing, pinching, falling)
 - A minimum number (4) of personnel must be trained for, and follow safety rules of the lifting equipment to be used. Safety glasses, shoes, and hardhats must be worn by personnel involved in the lifting and transporting of the Cartridge. At no time should work be done above head height while people are directly below.
- At no time should any person be beneath a suspended cartridge.
- Damage to equipment (from shifting or vibrations)
- Vibrations, Accelerations and Decelerations during liftoff, transport, and placement have the potential to damage items held in the suspensions or between the stages of the ISI. Therefore the ISI and items in the SUS frames must be locked down per the checklists and references in LIGO-E1200900 & LIGO-E1200344

5.2 Damage to the suspensions or isolation system from Impact

• Impact can cause damage directly to the suspension frames, Test Stand, or Chamber. Resulting movement of the suspended items in the frames during an impact can cause secondary damage. Chances of contact with optics table payload is significantly reduced by removing any items that might interfere with the Support Tubes or Chamber. In addition there are lateral moves (laid-out in BSC Requirements and procedures.. in: LIGO-E1200900) to avoid contact with potentially interfering items. The ISI and items in the SUS frames must be locked down per applicable checklists and references in LIGO-E1200900 & LIGO-E1200344.

5.3 Particulate contamination

- To protect delicate optics and other components, all guards, covers and caps, must be in place. All personnel must be trained and follow the detailed procedure and checklist to ensure all of the required items are in place
- Fabric covers are used over the entire cartridge assembly to catch particulates generated by the crane.

5.4 Cartridge Drop

• Failure of the lifting apparatus causing the cartridge to drop, could result in serious injury and loss of a significant portion of the cartridge hardware. Thus no person will be allowed below the cartridge or within a safety radius of it during liftoff, transport or

set-down. Only the crane operator and persons watching for close encounters and/or providing hand signals, shall be allowed in the area where the lift is being made. All others shall stay at a safe distance (20-feet minimum) away from lift activities. The exception to this is in the very early and late stages of liftoff and set-down while the cartridge is only a few inches away from the support tubes, which would shield anyone from the short drop of the cartridge. The cartridge will need to be inspected and guided at these two times. The dropping hazard is mitigated overall by the use of lifting hardware that has a 3 times yield, designed-in, safety factor. It should also be noted that it is recommended that bystanders refrain from talking/making noise that may disturb the concentration and communication of the personnel involved in the lift.

5.5 Failure of crane to operate or power failure during operation

• A failure of the crane lifting mechanism, or power loss during transport will result in the crane locking in place. This is not a safety problem, and covers will prevent contamination. See critical lift plan in LIGO-E1200901.

5.6 Structural failure of Crane

• The crane will not be operated beyond rated capacity. All items will be pre weighed, and must only be the ones expected per plans (<u>LIGO-E1200900</u> and <u>LIGO-E1101017</u>) to be part of the cartridge (no additional unexpected parts).

5.7 Drop/fall hazard due to assembly of components at height

• To prevent falls and dropped items from height, platforms and walking plates with kick panels and railings will be in place as needed around the BSC chamber. Also a Fall Arrest System will be used when railings cannot be used.

5.8 Crane does not allow cartridge to rotate, or jams at partial rotation

• Cartridge can be returned to test stand if hook pivot becomes stuck.


5.9 Cleanroom or platforms impact the Gate-Valve or plumbing.

• The cleanroom will be fitted with a 4" spacer between the two halves to provide clearance for the gate-valve motor box. A narrower version of Platform-C will be used in place of the original Platform-C to avoid contact with the gate-valve plumbing. Reference <u>LIGO-E1101051</u> (BSC Work Platforms), for setup and configuration of the platforms round the BSC Chambers.

5.10 Personnel strike hazard while moving cleanroom when people are resident on test stand work platforms.

• The test stand cleanroom is moved to allow crane access to the 3pt lifter and cartridge, when readying the system to be checked with a load cell and subsequently flown to chamber for install. Workers on test stand work platforms will typically hold curtains open to ensure the clear plastic drapes do not touch the ISI. However, cleanroom gussets

(cross-bracing) located at the corner of the ceiling (where the legs are affixed) has some chance to strike a worker when the cleanroom begins to clear the test stand. This puts the worker at risk for injury due to the strike, and due to a potential fall from the test stand that could follow (see Fig 5.10). The risk can be exacerbated if the cleanroom sits off-center relative to the test stand (which may happen owing to nearby interferences).

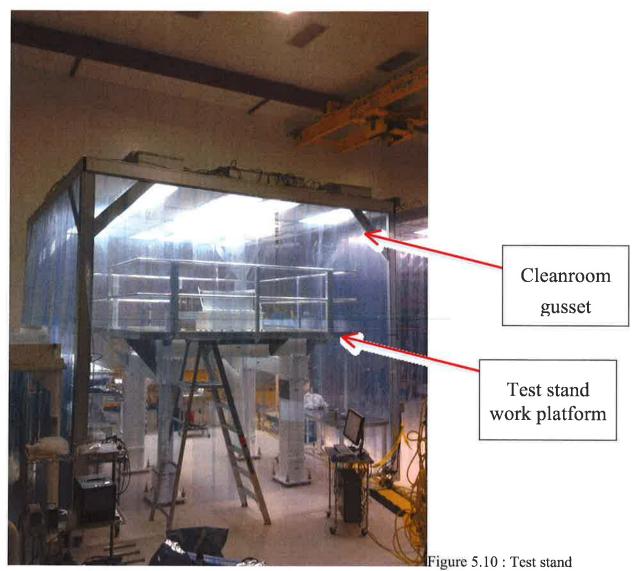

equipped with work platform. When being moved for crane access, gussets on cleanroom can interfere with workers on platform (in particular, if the cleanroom is offset from test stand center).



LIGO

6) Hazard Analysis Severity Table (The number in brackets is a reference back to section 2 summarizing the hazard)

4E	Improbable	Negligible	Return cartridge to test stand, repair crane		3D	Remote	Marginal	Wrong orientation	Hook Binds	Cranc rotation failure	(2.8)
2E	Improbable	Critical	Use barrier plates and railings as instructed, and personnel must wear safety glasses shoes hard hats	æ	2D	Remote	Critical	Injury to personnel; damage to equipment	On top of, or below Cartridge and above Support tubes	Assembly of components at height	7 (2.7)
N m	Improbable	Critical	All items to be lifted pre weighed, Test lift, Proper crane maintenance		2D	Remote	Critical	Injury to personnel; damage to equipment	Overloaded crane, poor crane related maintenance	Crane, structural failure	6 (2.6)
4E	Improbable	Negligible	lifting equipment should be inspected and maintained, so that a failure is unlikely. Do not operate at time when a power outage is likely.	Final weight of cartridge measured, insure crane within operating spec. at all times.	3D	Remote	Marginal	Nuisance, lost time	Lifting equipment not serviced or used as per instructions, power outage	Failure of lifting mechanism, power outage	5 (2.5)
N III	Improbable	Critical	Personnel must be trained and follow detailed procedure and checklist.	3X or better safety factor on all lifting equipment (Industry standard)	2D	Remote	Critical	Injury to personnel; damage to equipment	Improper use of interface tooling, linkages, crane	Payload drop hazard	4 (2,4)
CO	Remote	Marginal	C4 Cloth covers for cartridge and suspended components		3B	Probable	Marginal	damage to environment	Debris falling from above: crane etc. Removal of covers/caps	Particulate contamination	3 (2.3)
ω O	Remote	Marginal	Remove interfering items & lateral moves of cartridge to clear obstacles.	Damage concern mostly to suspensions during lift or lower, to stand or chamber	2B	Probable	Critical	Damage to mostly suspended items.	Interference with support tubes, Test Stand or chambers	Cartridge impact anywhere other than mounting surfaces.	2 (2.2)
4D	Remote	Negligible	A minimum number (4) of personnel must be trained for and follow safety rules of lifting equipment being used		2C	Occasional	Critical	Injury to personnel	Between Cartridge and Support tubes on Test Stand or in Chamber	Fingers/hand/arm pinching/crushing hazard	(2.1)
Mitigated Risk Index	Mitigated Probability Level	Mitigated Severity	Mitigation	Comment	Unmitigated Risk Index	Unmitigated Probability Level	Unmitigated Severity	Effect	Cause	Hazard	Item (Ref)*

Item	Hazard	Cause	Effect	Unmitigated	Unmitigated Probability	Unmitigated	Comment	Mitigation	Mitigated	Mitigated Probability	Mitigated Risk
(Ref)*				Severity	Level	Risk Index			Severity	-	Index
9 (2.9)	Gate Valve or plumbing damage	Impact with cleanroom/platforn	X/Y arm Vacuum leak	Critical	Remote	2D	Spacer added to cleanroom to clear gatevlave	New platform -C to clear plumbing/vlave, close gatevalve at cryopump	Marginal	Remote	G G
10 (2.10)	Strike from cleanroom when on test stand	Moving cleanroom without alerting workers on test stand	Injury to personnel	Critical	Occasional	2C	Risk is exacerbated by off-center cleanroom	Good communication from crew moving cleanroom to personnel on test stand	Marginal	Improbable	CO M


/) Key

Key to table in section 6

Less than minor injury, first aid or minor supportive medical treatment type of occupational illness, or less than minor system or environmental damage.	4	Minor
Minor injury, lost workday accident, minor occupational illness, or minor system or environmental damage	ω	Marginal
Severe injury, severe occupational illness, major system or environmental damage	2	Critical
Death or permanent total disability, system loss, major property damage or severe environmental damage	_	Catastrophic
Definition	Category	Severity

Probability	Level	Definition
Frequent	Α	Likely to occur frequently or continuously experienced
Probable	В	Will occur several times in the life of an item
Occasional	C	Likely to occur some time in the life of an item
Remote	D	Unlikely but possible to occur in the life of an item
Improbable	ш	So unlikely, it can be assumed occurrence may not be experienced.

1A, 1B, 1C, 2A, 2B, 3A 1D, 2C, 2D, 3B, 3C 1E, 2E, 3D, 3E, 4A, 4B 4C, 4D, 4E	Hazard Risk Index	Negligible	4	3 Marginal	2 Critical	1 Catastrophic	CONSEQUENCE	SEVERITY OF	
							Improbable	п	
Undesirable (Directorate d Acceptable with review by Acceptable without review		THE PARTY OF					Remote	D	
Unacceptable Undesirable (Directorate decision required) Acceptable with review by Directorate Acceptable without review	Risk Co						Occasional	С	PROBABILITY
luired) e	Code Criteria						Probable	В	
							Frequent	Α	

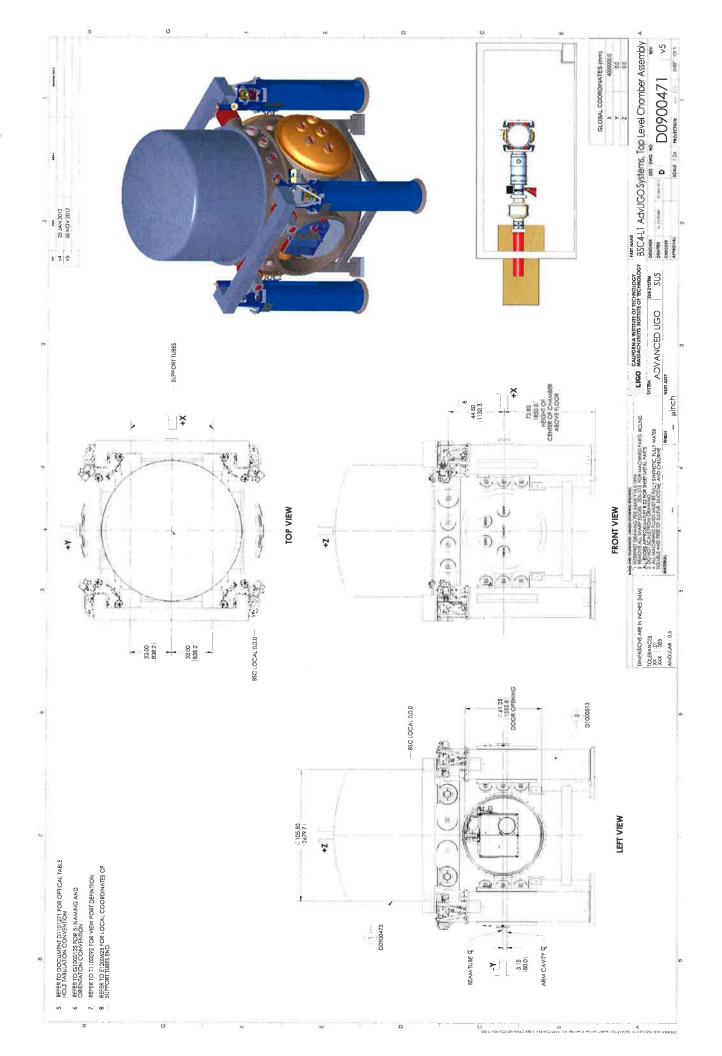






Ιſ¥


Complet /QTV	DISCRIPTION	PART NUMBER	NO
-	AdvUGO VE BSC44. Vocuum Equpmen Assembiy	DONIDATE	
,	Advisor SE BSCAL INTUROS CENTRASPE	200805077	6
*	AdvIIGO SUS BSCAL XYZ Laca CS TA PAIX	DOS00478	×
-	Advisor Sife 15C44) INT Local CS for FIM To: Assy	posmos	7
	HER ASSESSIVE SIC SOCIO	D DOC5 1	ú.
	Advisco Sus 85C4-L XYZ Laca CS for SLC Arm. Cavily Battle	0.100c3s	
	AdvilGO BSC4-L II. nore. The red & Suspended	D 200,000	2


LIGO CALIPORNA NSTITUTE OF TECHNOLOGY AND MASSACHUSTED STREET OF TECHNOLOGY AND PASSACHUSTED STREET OF TECHNOLOGY AND THE STREET OF T

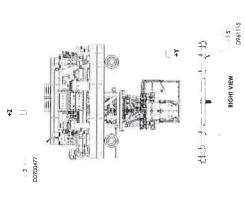


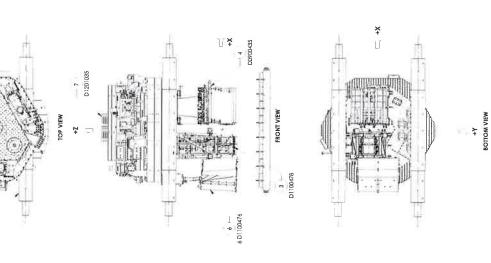

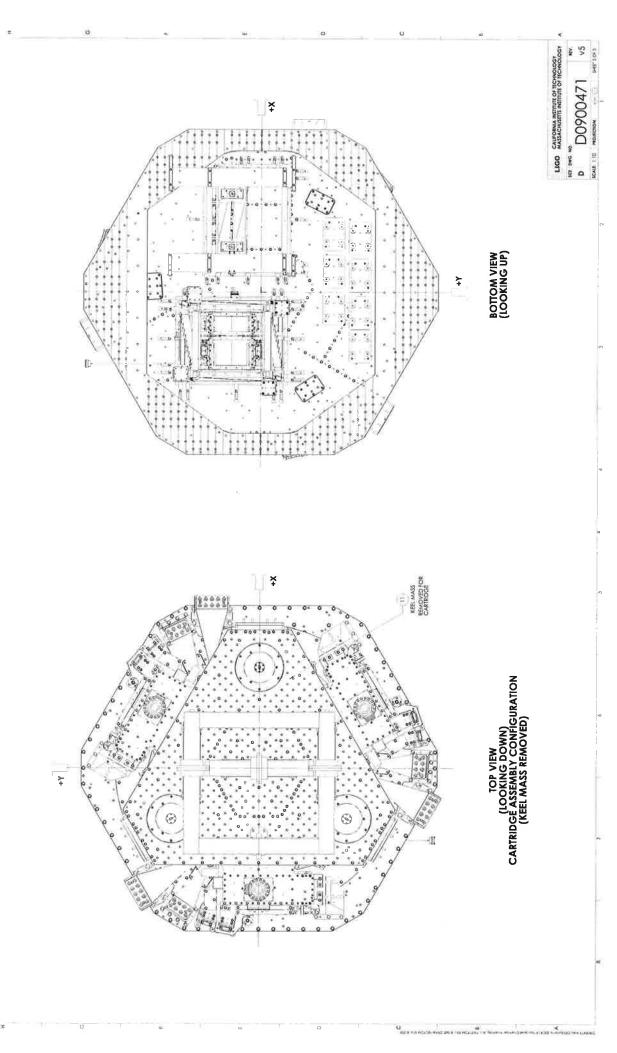

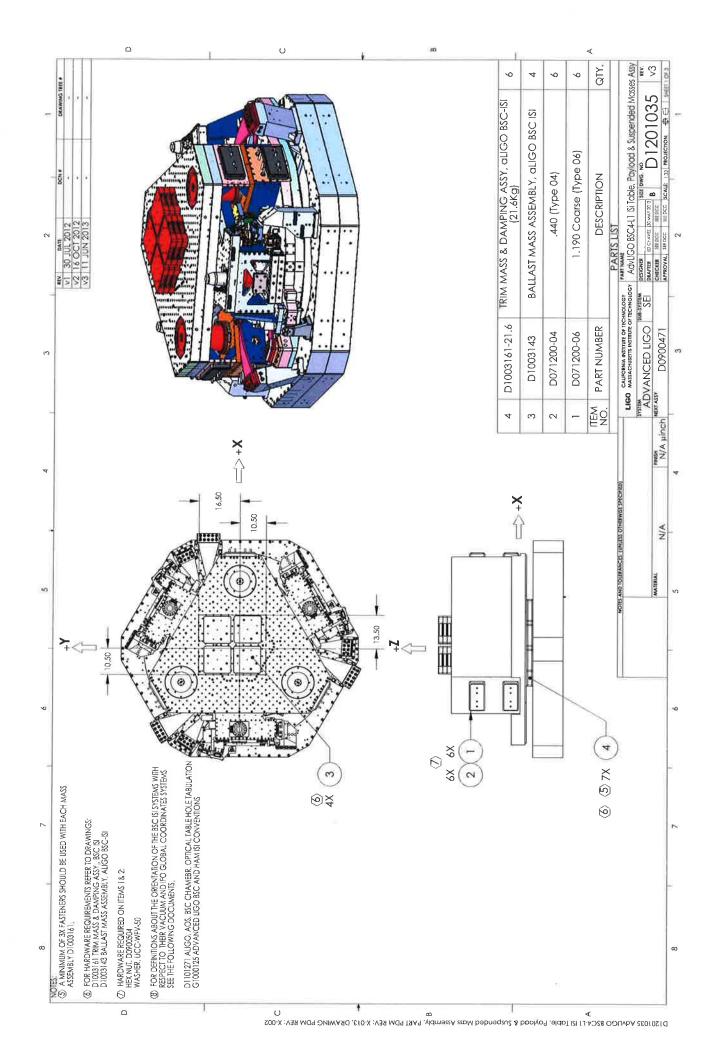

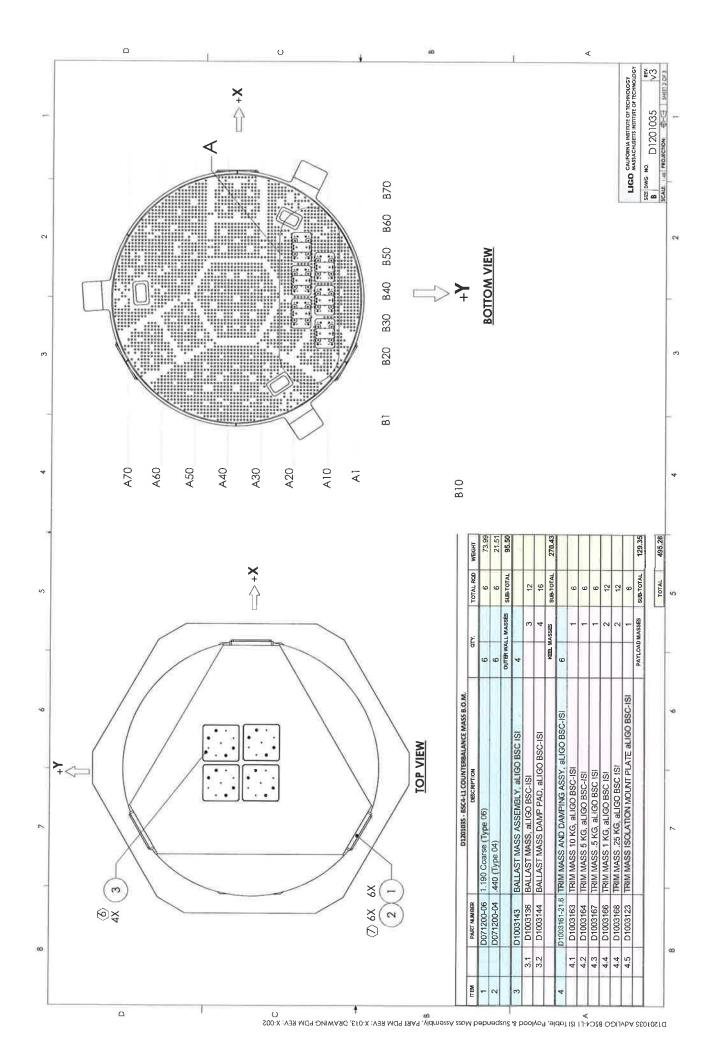

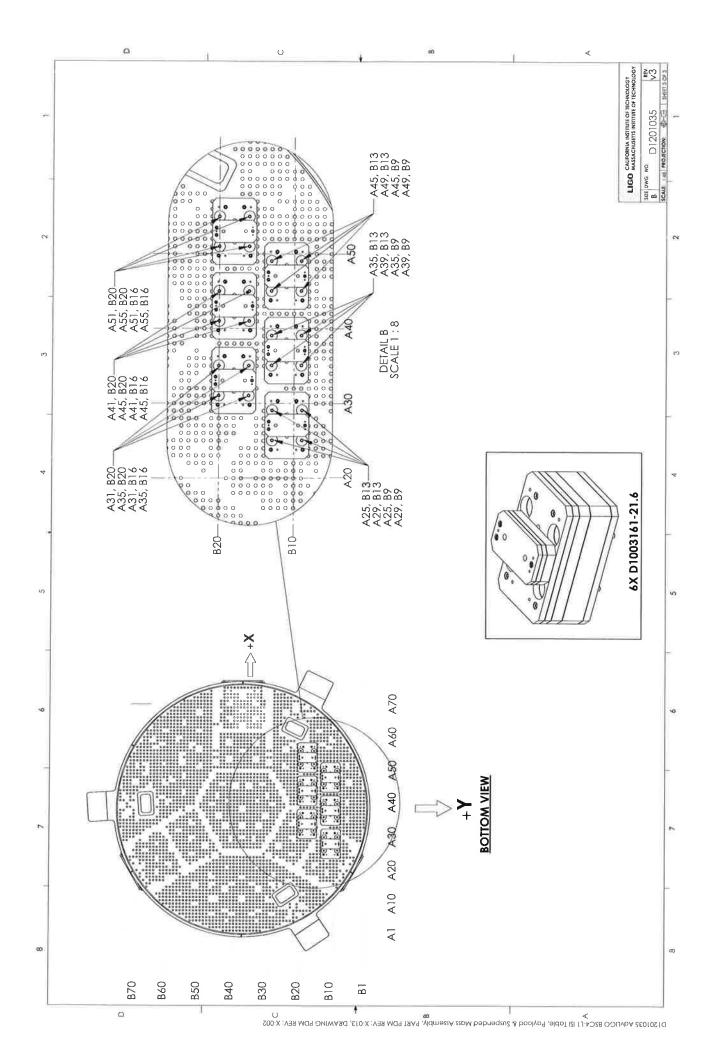



LIGO Laboratory / LIGO Scientific Collaboration

Clean Room Heights, Cartridge Install, BSC Chamber, aLIGO

Sam Barnum

Distribution of this document: LIGO Science Collaboration

This is an internal working note of the LIGO Project.

California Institute of Technology LIGO Project – MS 18-34 1200 E. California Blvd. Pasadena, CA 91125 Phone (626) 395-2129 Fax (626) 304-9834 E-mail: info@ligo.caltech.edu

P.O. Box 1970
Mail Stop S9-02
Richland, WA 99352
Phone (509) 372-8106
Fax (509) 372-8137

Massachusetts Institute of Technology LIGO Project – NW17-161 175 Albany St Cambridge, MA 02139 Phone (617) 253-4824 Fax (617) 253-7014 E-mail: info@ligo.mit.edu


P.O. Box 940
Livingston, LA 70754
Phone (225) 686-3100
Fax (225) 686-7189


http://www.ligo.caltech.edu/

- 9) Damage to Gate-Valve Plumbing and Gate Valve.
- 10) Personnel injury (strike or fall) when working on test stand platforms while cleanroom is moved away from test stand area.

3) Overview (Note: all pictures are examples from BSC6, but are applicable to BSC2)


3.1 Attach the three (3) Lift Hook Receivers (D1000753) on the ISI Keelplate, if not already present (See *D1000756* for layout and use Bumax-88 3/8"-16 Screws, Torque, 13-15 ft-lb).

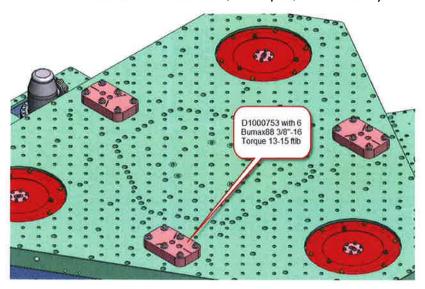


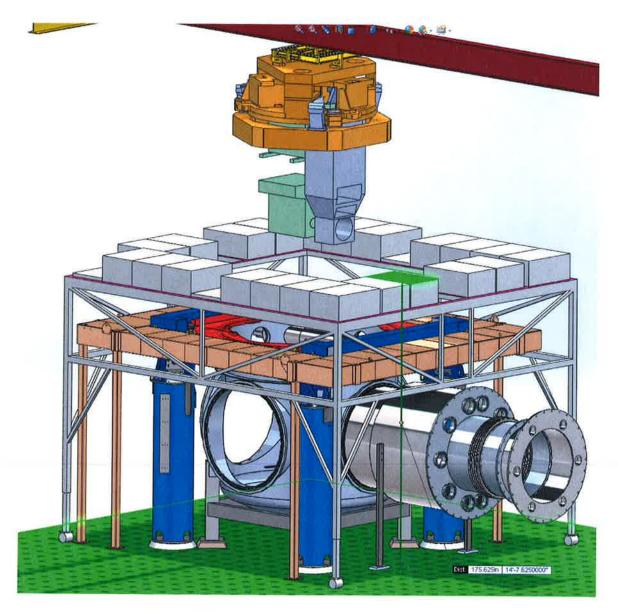


Enhanced minimum height bellow original design, $\sqrt{049}$ -4-133, $\sqrt{049}$ -4-135

2) Maximum Raised height, VO49-4-133, VO49-4-135

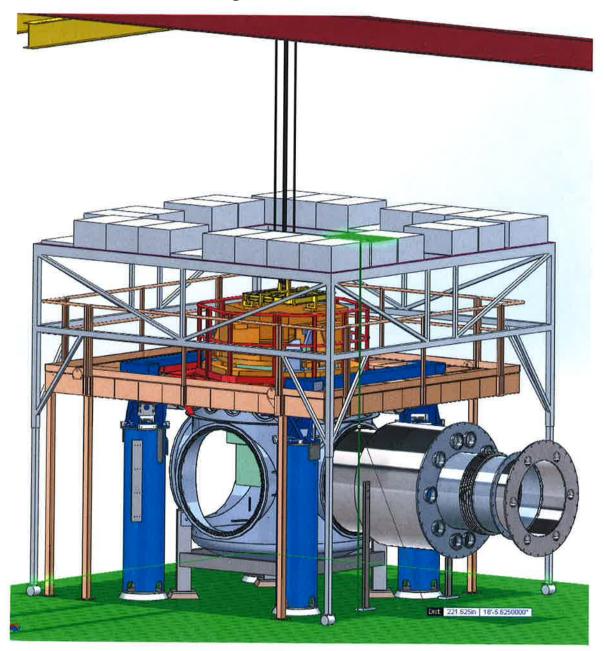

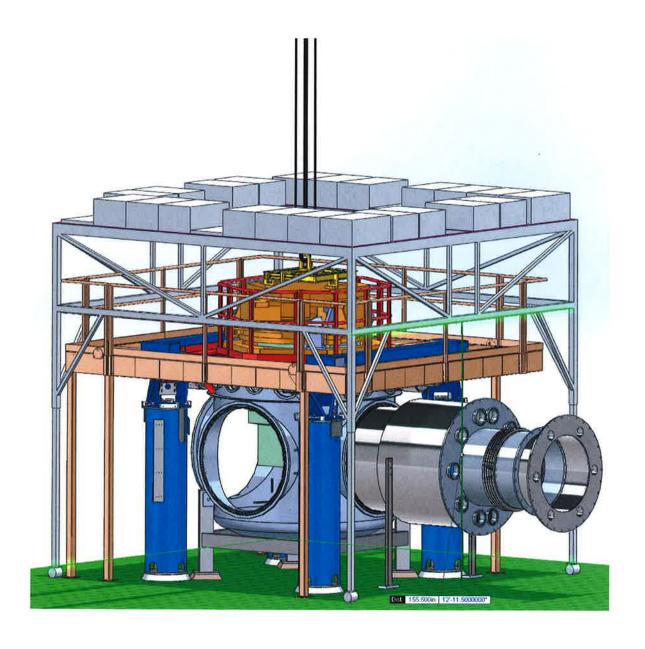

1) Minimum Lowered height

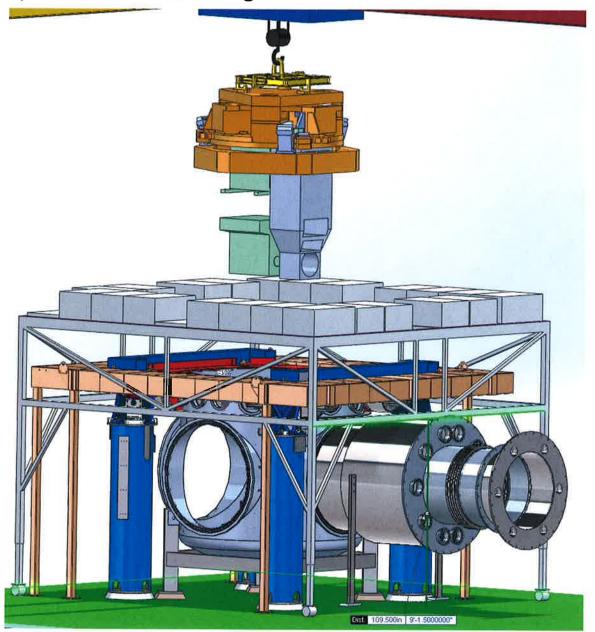

Enhanced minimum height bellow original design, $\lor 0.49-4-1.35$, $\lor 0.49-4-1.35$

193

Hook heights at LHO:

Y-end = 26' 4 1/2",

X-end = 25' 9 1/2"

Main North-0 = 26' 5",

Main North-1 = 26' 5",

Main North-2 = 26' 5",

Main North-3 = 26' 4 1/2".

183 12/299

Hook heights at LLO:

Y-End - 26' 8"


X-End 26' 2")


LVEA North - 26' 3"

LVEA East - 26' 1"


LVEA South - 26' 8"

LVEA West - 26' 5"

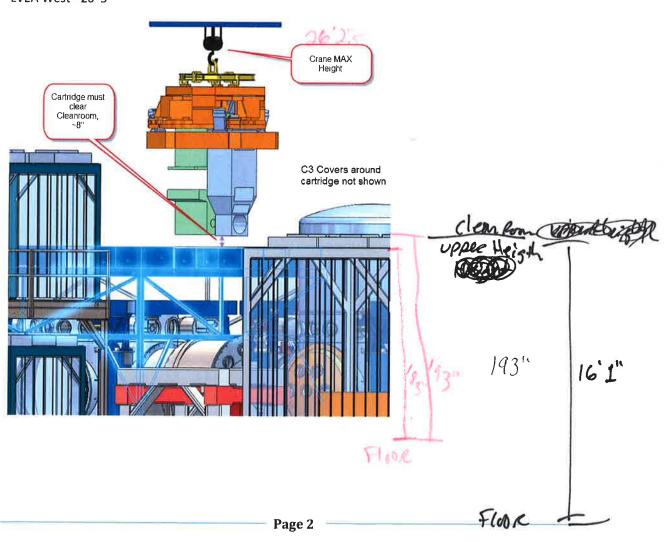

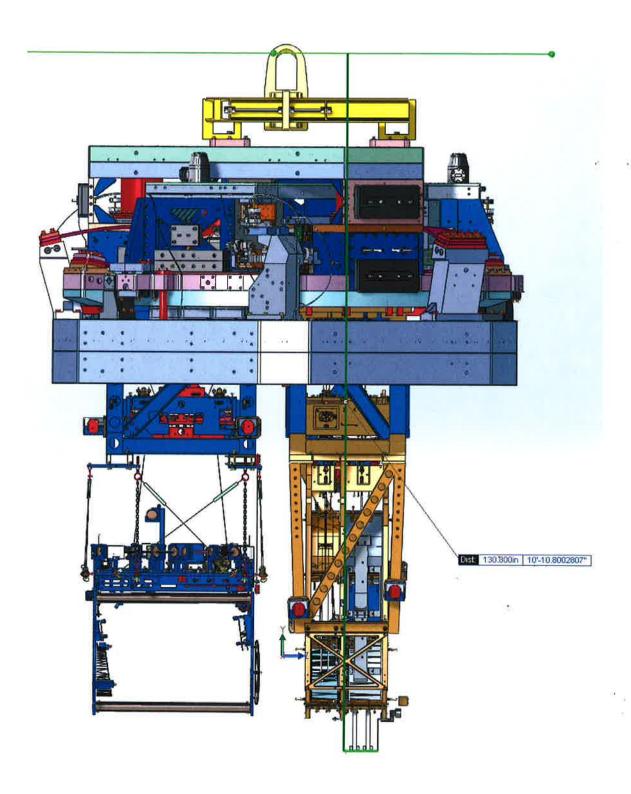

a CRAME INSpection/install 65 (donce toll · Hour charken Install DeBric Catel. attach Lister on ISI/with cartific lough + Do a start titt foper soft rover add and cover Brig ISI into Clearen / Leg Crew Start / Remove Done Cover O- Cover IST Rylapping Cover ASA Amount List thing I cristal the War Cover / Becz-30

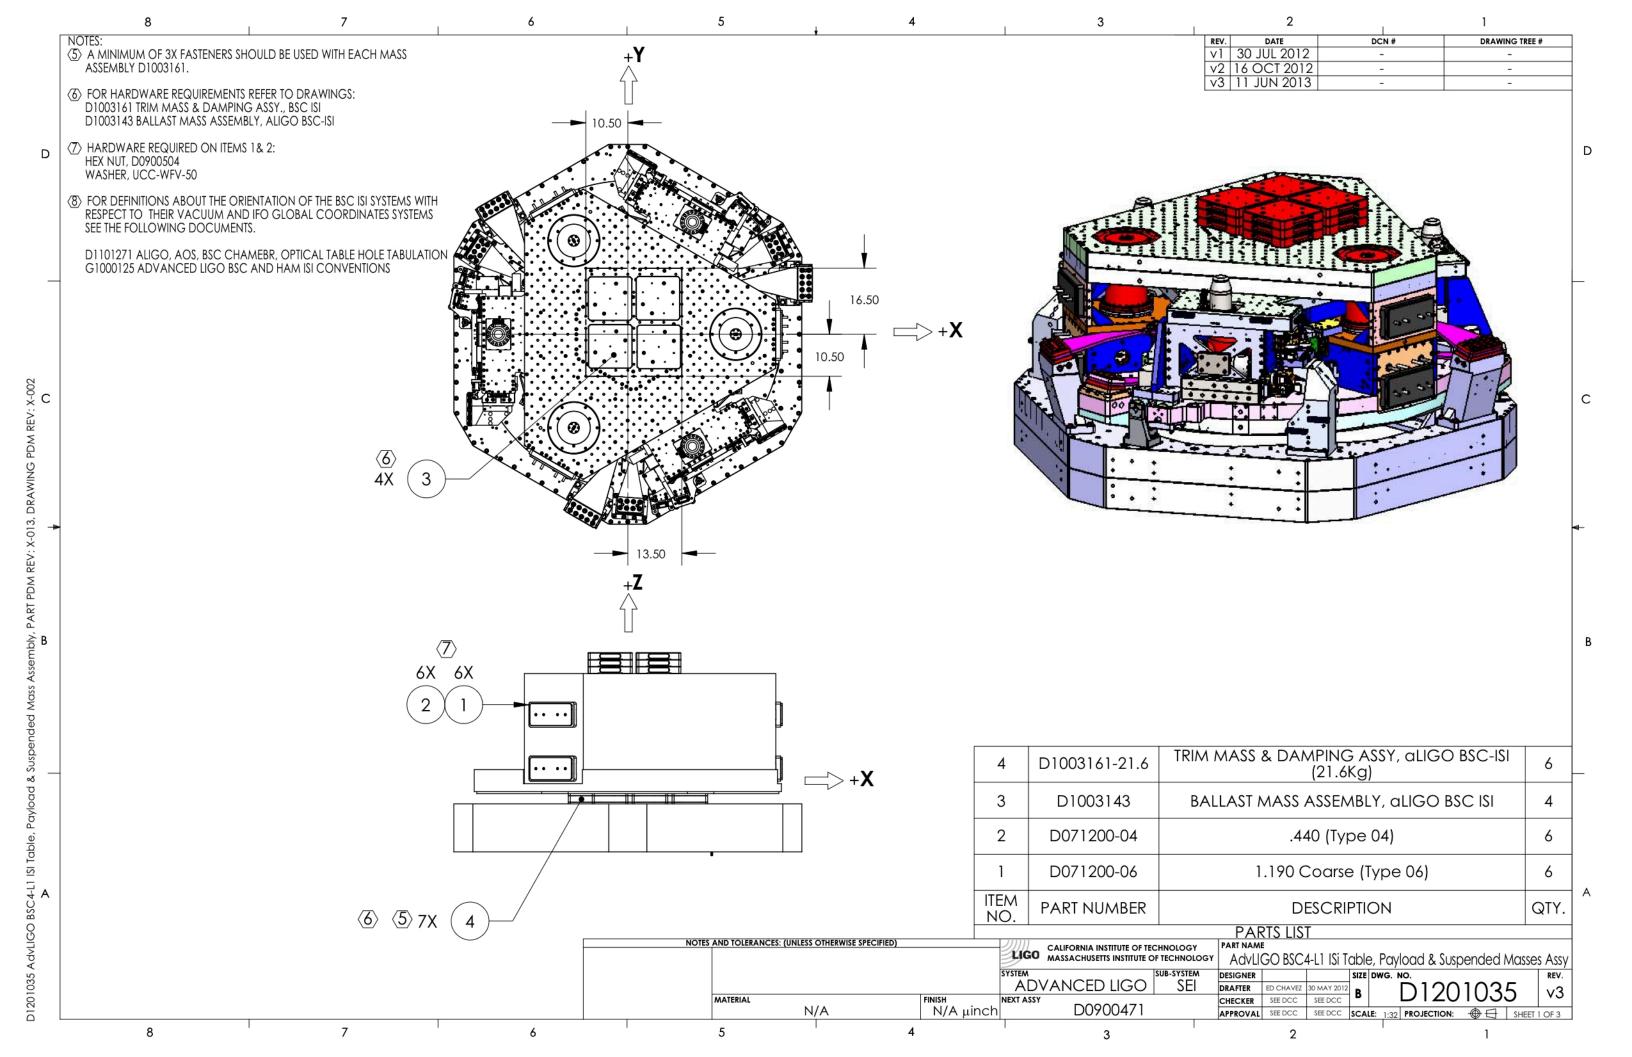



Ltd. giring Fill Om rdustria 0000

