LIGO LIGO HANF PO BOX 159 RICHLAND W

LIGO HANFORD OBSERVATORY PO BOX 159 RICHLAND WA 99352

TEL: 509.372.8190 FAX: 509.372.8137

MEMORANDUM

DATE: December 16, 2021

TO: ISC team FROM: Daniel Sigg

SUBJECT: Modifications to the VCO source boards (initial build)

Refer to: LIGO-E2100544-v1

Version 3 of VCO source boards, , as originally built, need the following modifications to reduce oscillations in the low noise power supply units.

Capacitors need to be NP0/COG or film, resistors need to be metal film.

Change 1:

Add improved compensation to PVCO supply.

 $\begin{array}{l} R69 \rightarrow 15~\Omega \\ C112 \rightarrow 470~pF \end{array}$

Change 2:

Add improved compensation to P20 supply.

 $R70 \rightarrow 15 \Omega$ $C113 \rightarrow 470 pF$ $C93 \rightarrow 2.2 \mu F$

Change 3:

Add improved compensation to VCC supply.

 $R52 \rightarrow 1 \ k\Omega$ $C87 \rightarrow 470 \ pF$ $C88 \rightarrow 47 \ \mu F$

BOM (for 1 board):

Qty	Item	Distributor	Description
3	399-C0805C471J5GAC7210CT-ND	Digi-Key	C112/C113/C87, 470 pF
2	RR1220Q-150-D	Digi-Key	R69/R70, 15 Ω
1	P1.0KDACT-ND	Digi-Key	R52, 1 kΩ
1	1276-3137-1-ND	Digi-Key	C88, 2.2 µF, 50V
1	490-5528-1-ND	Digi-Key	C88, 47 µF, 10V